

# PRO WELD

INTERNATIONAL

---

---

## ***ARC 800***



## ***OPERATION/MAINTENANCE MANUAL***



**TABLE OF CONTENTS**

<b>Section</b>		<b>PAGE</b>
<b>1</b>	<b>SAFETY PRECAUTIONS</b>	
<b>1.0</b>	<b>INTRODUCTION.....</b>	<b>1</b>
<b>2.0</b>	<b>WARRANTY.....</b>	<b>1</b>
<b>3.0</b>	<b>UNPACKING YOUR UNIT.....</b>	<b>1</b>
<b>4.0</b>	<b>SUGGESTED SAFETY PRECAUTIONS.....</b>	<b>1</b>
<b>4.1</b>	<b>PERSONAL SAFETY PRECAUTIONS.....</b>	<b>1</b>
<b>4.2</b>	<b>POWER SUPPLY PRECAUTIONS.....</b>	<b>2</b>
<b>5.0</b>	<b>GENERAL DESCRIPTION.....</b>	<b>2</b>
<b>6.0</b>	<b>ELECTRICAL INPUT REQUIREMENT.....</b>	<b>2</b>
<b>7.0</b>	<b>CONTROL PANEL DESCRIPTION.....</b>	<b>3</b>
<b>8.0</b>	<b>WELD GUN SETUP.....</b>	<b>3</b>
<b>8.1</b>	<b>PLUNGE LENGTH.....</b>	<b>3</b>
<b>8.2</b>	<b>CHECKING GUN LIFT.....</b>	<b>4</b>
<b>9.0</b>	<b>SETTING UP POWER SOURCE.....</b>	<b>5</b>
<b>9.1</b>	<b>CONNECTIONS AND SETTINGS.....</b>	<b>5</b>
<b>9.2</b>	<b>WELD TEST INSPECTIONS.....</b>	<b>5</b>
<b>10.0</b>	<b>MAINTENANCE.....</b>	<b>6</b>
<b>10.1</b>	<b>WELD CABLES.....</b>	<b>6</b>
<b>10.2</b>	<b>INTERNAL CLEANING.....</b>	<b>6</b>
<b>11.0</b>	<b>TROUBLESHOOTING.....</b>	<b>7</b>
<b>12.0</b>	<b>PARTS LIST.....</b>	<b>8,9,10,11</b>

**LIST OF FIGURES**

<b>1</b>	<b>JUMPER LINK ARRANGEMENT.....</b>	<b>2</b>
<b>2</b>	<b>CONTROL PANEL FRONT.....</b>	<b>3</b>
<b>3</b>	<b>STANDARD GUN SET-UP.....</b>	<b>4</b>
<b>4</b>	<b>WELD INSPECTION.....</b>	<b>5</b>
<b>5</b>	<b>FUSE BLOCK.....</b>	<b>6</b>
<b>6</b>	<b>FRONT PANEL.....</b>	<b>8</b>
<b>7</b>	<b>CONNECTORS.....</b>	<b>8</b>
<b>8</b>	<b>CONTROL UNIT-INTERNAL VIEW.....</b>	<b>9</b>
<b>9</b>	<b>CONTROL UNIT-INTERNAL VIEW.....</b>	<b>10</b>
<b>10</b>	<b>CURRENT CONTROL PCB.....</b>	<b>11</b>

## SECTION 1 – SAFETY PRECAUTIONS - READ BEFORE USING

### 1-1. Symbol Usage



Means Warning! Watch Out! There are possible hazards with this procedure! The possible hazards are shown in the adjoining symbols.

▲ Marks a special safety message.

☞ Means "Note"; not safety related.



This group of symbols means Warning! Watch Out! possible ELECTRIC SHOCK, MOVING PARTS, and HOT PARTS hazards. Consult symbols and related instructions below for necessary actions to avoid the hazards.

### 1-2. Arc Welding Hazards

▲ The symbols shown below are used throughout this manual to call attention to and identify possible hazards. When you see the symbol, watch out, and follow the related instructions to avoid the hazard. The safety information given below is only a summary of the more complete safety information found in the Safety Standards listed in Section NO TAG. Read and follow all Safety Standards.

▲ Only qualified persons should install, operate, maintain, and repair this unit.

▲ During operation, keep everybody, especially children, away.



#### ELECTRIC SHOCK can kill.

Touching live electrical parts can cause fatal shocks or severe burns. The electrode and work circuit is electrically live whenever the output is on. The input power circuit and machine internal circuits are also live when power is on. In semiautomatic or automatic wire welding, the wire, wire reel, drive roll housing, and all metal parts touching the welding wire are electrically live. Incorrectly installed or improperly grounded equipment is a hazard.

- Do not touch live electrical parts.
- Wear dry, hole-free insulating gloves and body protection.
- Insulate yourself from work and ground using dry insulating mats or covers big enough to prevent any physical contact with the work or ground.
- Do not use AC output in damp areas, if movement is confined, or if there is a danger of falling.
- Use AC output ONLY if required for the welding process.
- If AC output is required, use remote output control if present on unit.
- Disconnect input power or stop engine before installing or servicing this equipment. Lockout/tagout input power according to OSHA 29 CFR 1910.147 (see Safety Standards).
- Properly install and ground this equipment according to its Owner's Manual and national, state, and local codes.
- Always verify the supply ground – check and be sure that input power cord ground wire is properly connected to ground terminal in disconnect box or that cord plug is connected to a properly grounded receptacle outlet.
- When making input connections, attach proper grounding conductor first – double-check connections.
- Frequently inspect input power cord for damage or bare wiring – replace cord immediately if damaged – bare wiring can kill.
- Turn off all equipment when not in use.
- Do not use worn, damaged, undersized, or poorly spliced cables.
- Do not drape cables over your body.

- If earth grounding of the workpiece is required, ground it directly with a separate cable – do not use work clamp or work cable.
- Do not touch electrode if you are in contact with the work, ground, or another electrode from a different machine.
- Use only well-maintained equipment. Repair or replace damaged parts at once. Maintain unit according to manual.
- Wear a safety harness if working above floor level.
- Keep all panels and covers securely in place.
- Clamp work cable with good metal-to-metal contact to workpiece or worktable as near the weld as practical.
- Insulate work clamp when not connected to workpiece to prevent contact with any metal object.
- Do not connect more than one electrode or work cable to any single weld output terminal.

#### SIGNIFICANT DC VOLTAGE exists after removal of input power on inverters.

- Turn Off inverter, disconnect input power, and discharge input capacitors according to instructions in Maintenance Section before touching any parts.



#### FUMES AND GASES can be hazardous.

Welding produces fumes and gases. Breathing these fumes and gases can be hazardous to your health.

- Keep your head out of the fumes. Do not breathe the fumes.
- If inside, ventilate the area and/or use exhaust at the arc to remove welding fumes and gases.
- If ventilation is poor, use an approved air-supplied respirator.
- Read the Material Safety Data Sheets (MSDSs) and the manufacturer's instructions for metals, consumables, coatings, cleaners, and degreasers.
- Work in a confined space only if it is well ventilated, or while wearing an air-supplied respirator. Always have a trained watchperson nearby. Welding fumes and gases can displace air and lower the oxygen level causing injury or death. Be sure the breathing air is safe.
- Do not weld in locations near degreasing, cleaning, or spraying operations. The heat and rays of the arc can react with vapors to form highly toxic and irritating gases.
- Do not weld on coated metals, such as galvanized, lead, or cadmium plated steel, unless the coating is removed from the weld area, the area is well ventilated, and if necessary, while wearing an air-supplied respirator. The coatings and any metals containing these elements can give off toxic fumes if welded.



### ARC RAYS can burn eyes and skin.

Arc rays from the welding process produce intense visible and invisible (ultraviolet and infrared) rays that can burn eyes and skin. Sparks fly off from the weld.


- Wear a welding helmet fitted with a proper shade of filter to protect your face and eyes when welding or watching (see ANSI Z49.1 and Z87.1 listed in Safety Standards).
- Wear approved safety glasses with side shields under your helmet.
- Use protective screens or barriers to protect others from flash and glare; warn others not to watch the arc.
- Wear protective clothing made from durable, flame-resistant material (leather and wool) and foot protection.



### WELDING can cause fire or explosion.

Welding on closed containers, such as tanks, drums, or pipes, can cause them to blow up. Sparks can fly off from the welding arc. The flying sparks, hot workpiece, and hot equipment can cause fires and burns. Accidental contact of electrode to metal objects can cause sparks, explosion, overheating, or fire. Check and be sure the area is safe before doing any welding.

- Protect yourself and others from flying sparks and hot metal.
- Do not weld where flying sparks can strike flammable material.
- Remove all flammables within 35 ft (10.7 m) of the welding arc. If this is not possible, tightly cover them with approved covers.
- Be alert that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas.
- Watch for fire, and keep a fire extinguisher nearby.
- Be aware that welding on a ceiling, floor, bulkhead, or partition can cause fire on the hidden side.
- Do not weld on closed containers such as tanks, drums, or pipes, unless they are properly prepared according to AWS F4.1 (see Safety Standards).
- Connect work cable to the work as close to the welding area as practical to prevent welding current from traveling long, possibly unknown paths and causing electric shock and fire hazards.
- Do not use welder to thaw frozen pipes.
- Remove stick electrode from holder or cut off welding wire at contact tip when not in use.
- Wear oil-free protective garments such as leather gloves, heavy shirt, cuffless trousers, high shoes, and a cap.
- Remove any combustibles, such as a butane lighter or matches, from your person before doing any welding.

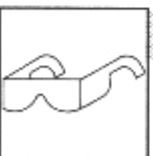

### FLYING METAL can injure eyes.

- Welding, chipping, wire brushing, and grinding cause sparks and flying metal. As welds cool, they can throw off slag.
- Wear approved safety glasses with side shields even under your welding helmet.



### BUILDUP OF GAS can injure or kill.

- Shut off shielding gas supply when not in use.
- Always ventilate confined spaces or use approved air-supplied respirator.



### HOT PARTS can cause severe burns.

- Do not touch hot parts bare handed.
- Allow cooling period before working on gun or torch.



### MAGNETIC FIELDS can affect pacemakers.

- Pacemaker wearers keep away.
- Wearers should consult their doctor before going near arc welding, gouging, or spot welding operations.



### NOISE can damage hearing.

Noise from some processes or equipment can damage hearing.

- Wear approved ear protection if noise level is high.



### CYLINDERS can explode if damaged.

Shielding gas cylinders contain gas under high pressure. If damaged, a cylinder can explode. Since gas cylinders are normally part of the welding process, be sure to treat them carefully.

- Protect compressed gas cylinders from excessive heat, mechanical shocks, slag, open flames, sparks, and arcs.
- Install cylinders in an upright position by securing to a stationary support or cylinder rack to prevent falling or tipping.
- Keep cylinders away from any welding or other electrical circuits.
- Never drape a welding torch over a gas cylinder.
- Never allow a welding electrode to touch any cylinder.
- Never weld on a pressurized cylinder – explosion will result.
- Use only correct shielding gas cylinders, regulators, hoses, and fittings designed for the specific application; maintain them and associated parts in good condition.
- Turn face away from valve outlet when opening cylinder valve.
- Keep protective cap in place over valve except when cylinder is in use or connected for use.
- Read and follow instructions on compressed gas cylinders, associated equipment, and CGA publication P-1 listed in Safety Standards.

## 1-3. Additional Symbols for Installation, Operation, and Maintenance



### FIRE OR EXPLOSION hazard.

- Do not install or place unit on, over, or near combustible surfaces.
- Do not install unit near flammables.
- Do not overload building wiring – be sure power supply system is properly sized, rated, and protected to handle this unit.



### MOVING PARTS can cause injury.

- Keep away from moving parts such as fans.
- Keep all doors, panels, covers, and guards closed and securely in place.




### FALLING UNIT can cause injury.

- Use lifting eye to lift unit only, NOT running gear, gas cylinders, or any other accessories.
- Use equipment of adequate capacity to lift and support unit.
- If using lift forks to move unit, be sure forks are long enough to extend beyond opposite side of unit.



### H.F. RADIATION can cause interference.

- High-frequency (H.F.) can interfere with radio navigation, safety services, computers, and communications equipment.
- Have only qualified persons familiar with electronic equipment perform this installation.
- The user is responsible for having a qualified electrician promptly correct any interference problem resulting from the installation.
- If notified by the FCC about interference, stop using the equipment at once.
- Have the installation regularly checked and maintained.
- Keep high-frequency source doors and panels tightly shut, keep spark gaps at correct setting, and use grounding and shielding to minimize the possibility of interference.

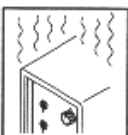

### OVERUSE can cause OVERHEATING

- Allow cooling period; follow rated duty cycle.
- Reduce current or reduce duty cycle before starting to weld again.
- Do not block or filter airflow to unit.



### STATIC (ESD) can damage PC boards.

- Put on grounded wrist strap BEFORE handling boards or parts.
- Use proper static-proof bags and boxes to store, move, or ship PC boards.



### MOVING PARTS can cause injury.

- Keep away from moving parts.
- Keep away from pinch points such as drive rolls.



### WELDING WIRE can cause injury.

- Do not press gun trigger until instructed to do so.
- Do not point gun toward any part of the body, other people, or any metal when threading welding wire.



### ARC WELDING can cause interference.

- Electromagnetic energy can interfere with sensitive electronic equipment such as computers and computer-driven equipment such as robots.
- Be sure all equipment in the welding area is electromagnetically compatible.
- To reduce possible interference, keep weld cables as short as possible, close together, and down low, such as on the floor.
- Locate welding operation 100 meters from any sensitive electronic equipment.
- Be sure this welding machine is installed and grounded according to this manual.
- If interference still occurs, the user must take extra measures such as moving the welding machine, using shielded cables, using line filters, or shielding the work area.

## 1-4. Principal Safety Standards

*Safety in Welding and Cutting*, ANSI Standard Z49.1, from American Welding Society, 550 N.W. LeJeune Rd, Miami FL 33126

*Safety and Health Standards*, OSHA 29 CFR 1910, from Superintendent of Documents, U.S. Government Printing Office, Washington, D.C. 20402.

*Recommended Safe Practices for the Preparation for Welding and Cutting of Containers That Have Held Hazardous Substances*, American Welding Society Standard AWS F4.1, from American Welding Society, 550 N.W. LeJeune Rd, Miami, FL 33126

*National Electrical Code*, NFPA Standard 70, from National Fire Protection Association, Batterymarch Park, Quincy, MA 02269.

*Safe Handling of Compressed Gases in Cylinders*, CGA Pamphlet P-1, from Compressed Gas Association, 1235 Jefferson Davis Highway, Suite 501, Arlington, VA 22202.

*Code for Safety in Welding and Cutting*, CSA Standard W117.2, from Canadian Standards Association, Standards Sales, 178 Rexdale Boulevard, Rexdale, Ontario, Canada M9W 1R3.

*Safe Practices For Occupation And Educational Eye And Face Protection*, ANSI Standard Z87.1, from American National Standards Institute, 1430 Broadway, New York, NY 10018.

*Cutting And Welding Processes*, NFPA Standard 51B, from National Fire Protection Association, Batterymarch Park, Quincy, MA 02269.

### 1-5. EMF Information

#### Considerations About Welding And The Effects Of Low Frequency Electric And Magnetic Fields

Welding current, as it flows through welding cables, will cause electromagnetic fields. There has been and still is some concern about such fields. However, after examining more than 500 studies spanning 17 years of research, a special blue ribbon committee of the National Research Council concluded that: "The body of evidence, in the committee's judgment, has not demonstrated that exposure to power-frequency electric and magnetic fields is a human-health hazard." However, studies are still going forth and evidence continues to be examined. Until the final conclusions of the research are reached, you may wish to minimize your exposure to electromagnetic fields when welding or cutting.

To reduce magnetic fields in the workplace, use the following procedures:

1. Keep cables close together by twisting or taping them.
2. Arrange cables to one side and away from the operator.
3. Do not coil or drape cables around your body.
4. Keep welding power source and cables as far away from operator as practical.
5. Connect work clamp to workpiece as close to the weld as possible.

#### **About Pacemakers:**

Pacemaker wearers consult your doctor first. If cleared by your doctor, then following the above procedures is recommended.

## 1.0 INTRODUCTION

Your new stud welding equipment has been carefully constructed using the finest components and material available. Used properly, this equipment will give you many years of profitable, efficient service.

The system incorporates the latest in engineering advances for complete, reliable end welding of mild steel, stainless steel and aluminum fasteners.

A careful study of this manual will enable you to understand how the welder operates to insure proper performance under all conditions.

## 2.0 WARRANTY

The electrical and mechanical components of the stud welder are thoroughly performance inspected prior to assembly in the welder. The assembled welder is completely performance checked. The welder is delivered to you in functional electro-mechanical condition.

All parts used in the assembly of the welder and its accessories are fully warranted for a period of 1 YEAR from the date of delivery. In addition, the welding capacitors are warranted for a period of 1 YEAR from the date of delivery. The printed circuit boards used in all proweld equipment are warranted for a period of 3 years.

Under the warranty, the manufacturer reserves the right to repair or replace, at their option, defective parts which fail during the guarantee period. Notice of any claim for warranty repair or replacement must be furnished to the manufacturer by the purchaser within ten (10) days after the defect is first discovered. The manufacturer does not assume any liability for paying shipping cost or any labor or materials furnished where such cost are not expressly authorized in writing.

The manufacturer does not warrant any parts or accessories against failures resulting from misuse, abuse, improper installation, maladjustment, or use not in accordance with the operating instructions furnished by the manufacturer. The warranty is valid only when studs are purchased from sources approved by the manufacturer or are of identical specifications to the manufacturer's

## 3.0 UNPACKING YOUR UNIT

Upon receipt of your unit, place it as close as possible to the point of installation before unpacking it. Once the unit is unpacked, it is recommended that you inspect it for any physical damage that may have occurred in shipping.

Your unit has been completely assembled and inspected at the factory. Upon receipt, the unit must be hooked up to the recommended incoming power before welding.

Place the unit in a large enough area to provide adequate ventilation. Do not restrict the air flow around the front louvers or from the fan at the rear of the unit. Do not allow water to enter the unit in any way.

## 4.0 SUGGESTED SAFETY PRECAUTIONS

In any welding operation, it is the responsibility of the welder to observe all safety rules to insure his or her personal safety and to protect those working in the area.

Reference is directed without endorsement or recommendation to ANSI Z49.1, Safety in Welding and Cutting, and to AWG Publication A6, 1-66, Recommended Safe Practices for Gas-Shielded Arc Welding.

### 4.1 PERSONAL SAFETY PRECAUTIONS

1. Always treat electricity with respect. Under open circuit conditions, the welding machines output voltage may be dangerous.
2. Don't work on live circuits or conductors. Disconnect the main power before checking the machine or performing any maintenance or repair operations.
3. Be sure the welding machine cabinet is properly grounded to a good electrical ground. Consult local electrical codes.
4. Never operate a welder in the rain, or operate a welder while standing in water. Avoid wearing wet or sweaty clothes when welding.
5. Don't operate with worn or poorly connected cables, and don't operate the weld gun with loose cable connections. Inspect all cables frequently for insulation failures, exposed wires, loose connections and repair as needed.
6. Don't overload welding cables or continue to operate with over heated cables.
7. Don't weld near flammable materials or liquids in or near the area, or on ducts or pipes carrying explosive gases.
8. Don't weld on containers which have held combustible or flammable materials, or on materials which give off flammable or toxic vapors when heated.



9. Be sure to provide proper ventilation when welding in a confined area.
10. Never look at the electric arc without wearing protective eye shields.
11. Always use the proper protective clothing, gloves, etc.
12. Never strike an arc when near a bystander who is unaware of the dangers of ultraviolet light to their eyes.

**4.2 POWER SUPPLY SAFETY PRECAUTIONS**

1. Always connect the frame to the power supply to ground in accordance with the National Electrical Code and the manufacturer’s recommendations.
2. Installation, servicing, or trouble shooting should be done by qualified personnel trained to work on this type of equipment.
3. Before servicing this piece of equipment, turn off the disconnect switch at the fuse box.
4. When in operation, all the covers must be on the equipment.

**5.0 GENERAL DESCRIPTION**

**THE PROCESS**

Stud welding is a time saving tool which semi-automatically arc welds the FULL CROSS-SECTION of a weld stud to the base material in a fraction of a second and develops superior strength over normal arc welding procedures.

Since the **ARC-800** stud welding system provides the proper arc length and allows you to select the proper arc time and welding current, the variables that affect weld quality are minimized.

**THE UNIT**


The **ARC-800** is a compact and portable stud welding power supply capable of welding studs through 1/2” diameter weld base. The power supply which operates on single phase power has the added feature of weld current regulation that improves stud welding consistency. Both the weld time and weld current are infinitely adjustable for preciseness and repeatability  
A specially designed electronic gun control circuit has been incorporated in this system. If a fault condition occurs due to

**6.0 ELECTRICAL INPUT REQUIREMENT**

This welding power source is designed to be operated from single-phase, 60 Hertz, AC power supply which has a line voltage rating that corresponds with one of the electrical input voltage shown on the nameplate or input data label. Adequate incoming power must be available to obtain maximum performance.

The **ARC-800** should be operated from a separate fused or circuit breaker protected circuit. Install two primary leads plus one ground wire (see table for proper wire and fuse sizes) through the inlet hole in the rear of the unit, using proper strain relief. The primary cables connect to terminals L or line. A third lead (ground connection) should be fastened to the terminal labeled “GND”. The other end the ground lead or cable should be attached to a suitable ground such as a water pipe, ground rod, ect.

Use whatever grounding means is acceptable to the local electrical inspection authorities. Consult the local electric utility if there is any question about the type of electrical system available at the installation site or how proper connections to the welding power source are to be made.

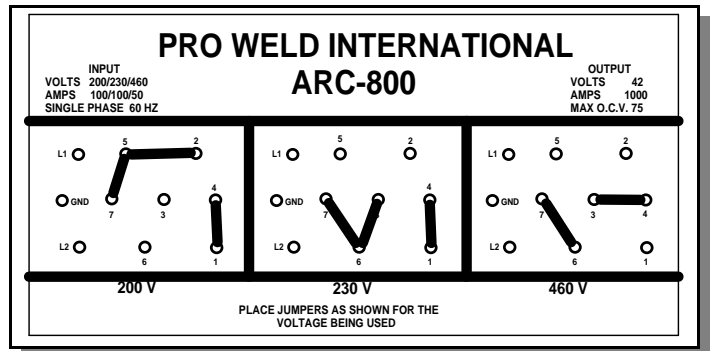

**Figure 1  
Jumper Link Arrangement**

PRIMARY WIRE	SIZE-AWG	DELAY TYPE FUSE GND	SIZE IN AMPS
208V	#4	#10	100
230V	#4	#10	100
460V	#10	#10	50

This unit is equipped with input voltage jumper links either installed or in a bag on the jumper link board to allow operation from different line voltages. If installed, the jumper links are positioned for the highest voltage stated on the nameplate or on the input data label. In either case the jumper links should always be checked to see if they are properly positioned for the voltage being used.

Open the access door located on the lower portion of the rear panel to expose the jumper link board. If necessary, reposition the jumper links to match the line voltage being used. (see Figure 1)



Figure 2  
CONTROL PANEL FRONT

a shorted gun solenoid or a faulty control cable, the circuit will prevent gun triggering and eliminate damage to printed circuit boards.

### 7.0 CONTROL PANEL DESCRIPTION

#### ON/OFF SWITCH

The ARC-800 is turned “ON” by turning the knob on the switch to the “ON” position.

#### WELD TIME ADJUSTMENT

The weld timer regulates duration of the weld current. The timer is calibrated in seconds from .05 to .6 seconds.

#### WELD CURRENT ADJUSTMENT

The weld current is adjustable 100-900 Amperes.

#### GUN FAULT LED INDICATOR

The gun fault LED “on” indicates a shorted gun solenoid or a shorted control cable. The LED will stay “on” and lock out the gun from triggering.

#### TRIGGER LED

The trigger LED “on” indicates a complete circuit to the unit through the gun control cables and gun switch. This LED will turn “on” whenever gun trigger is pressed.

### 8.0 WELD GUN SET-UP


#### 8.1 Plunge Length

1. A different and correctly sized chuck and ferrule grip are needed for each different stud diameter and style that will be welded (see PRO WELD Accessories catalog for help in this area). The appropriate chuck, or stud holder, is inserted into the tapered chuck adapter and tapped lightly to insure a tight fit. The ferrule grip is inserted in the hole in the foot and secured with the locking screws to hold it in place.

2. Studs must NOT bind or hang up on the foot, ferrule grip, or ferrule during the entire stud welding process. To assure this, the foot/ferrule arrangement must be centered in relation to the stud to be welded. To assure centering, loosen the leg screws that hold the foot to the legs. Place a stud in the chuck and a ferrule in the ferrule grip. With the leg screws loosened, the foot will move freely in all directions. Adjust the foot so that the stud is centered in the ferrule and no contact occurs between the stud and the ferrule during retraction or forward plunge of the stud.

3. The “plunge length” is the amount of the stud exposed beyond the ferrule during initial set-up. Set the plunge by loosening the leg adjusting screws and moving the foot until the stud extends 1/8” to 3/16” past the end of the ferrule. Tighten the leg adjusting screws after setting the plunge and recheck centering to be sure the stud is aligned properly in the ferrule.

4. The lift height, which determines the arc length, has been preset at the factory and will automatically lift and plunge the stud during the welding process. “Lift”, is the distance the gun will raise the stud above the welding surface during the weld. This distance governs the voltage and the arc. Improper lift will cause unsatisfactory welds. Refer to paragraph 8-1 if it becomes necessary to adjust the lift height.

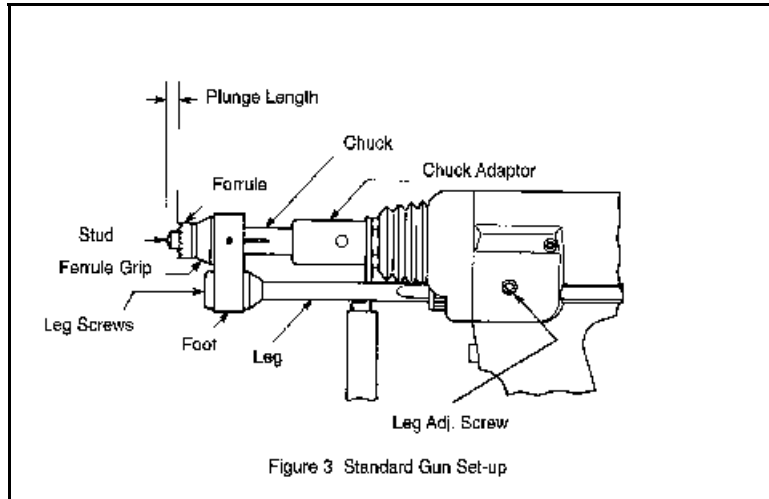

5. Make sure that the cables are connected to the power source (standard set-up is straight polarity - Negative to controller (or gun) and Positive (ground cable) to the work surface).

6. Turn on the power supply and adjust the current and time for the weld base diameter of the fastener to be welded.

7. Place the gun, loaded with the stud and ferrule, squarely against the grounded work surface. The main spring in the gun will take up the "plunge length" and the ferrule will seat against the base plate.

**DO NOT MOVE THE GUN DURING THE WELD CYCLE**

8. Pull the trigger holding the gun completely still as above. The gun will lift the stud from the base plate and draw an arc. The end of the stud and the adjacent material of the base plate, will be melted by the weld arc. The gun will then plunge the stud into the molten pool, extinguishing the arc, to end the controlled portion of the weld cycle.

9. After the controlled weld cycle, allow the molten metal to solidify briefly with the work surface to assure completion of the cycle (about an extra second holding "still" after the weld is usually sufficient).

10. Remove the gun from the work by lifting straight away from the welded stud (this will assure better life to the gun's expendable accessories). The ferrule may now be removed

by breaking it away from the welded stud to allow inspection of the weld results. After inspection of sample welds the gun can be adjusted, as per the step in this procedure, for optimum results.

**8.2 Checking Gun Lift**

To measure lift, turn the stud welding unit on and set the timer to maximum time. (On certain units there may be a Lift Check switch available, and in these cases this switch can be used to check lift.) Trigger the gun in the air, or on a non-grounded or insulated surface, to observe the lift cycle. Measuring the distance the stud or gun mechanism moves equals lift - usually this can be easily done by visual observation or simple measurement against a static reference point (i.e. the ferrule properly seated in the ferrule grip).

**Recommended Lift Settings.**

Stud Base Dia.	Lift Setting
Less than 1/2"	1/16"
1/2" through 3/4"	3/32"
Greater than 3/4"	7/64"

When it does become necessary to adjust lift, you do so by removing the rear cap from the gun. This will expose the rear coil yoke assembly, the set screw and the lift adjusting screw (Loosen the set screw to avoid damaging the threads of the lift adjusting screw).

To increase lift: turn the lift adjusting screw out (counter clockwise).

**9.0 SETTING UP THE POWER SOURCE**

**9.1 Connections and settings.**

**CAUTION**

Turn the power off before making connections

- a) Connect the male end of the GROUND CABLE to the positive GROUND terminal of the power supply, and secure the “C” clamp to the base plate. Make sure both connections are tight and the base metal is free of heavy paint or rust at the ground connection points.
- b) Connect the male end of the COMBINATION CABLE SET to the negative GUN terminal of the power supply.
- c) Plug in the control cable portion of the COMBINATION CABLE SET into the control cable receptacle in the front of the power supply.
- d) Set the Time adjustment required for the particular stud size. (see table 9-1)
- e) Set the Current adjustment to the current setting for the particular stud size. (see table 9-1)
- f) Turn on the power supply by depressing the START button.

**Table 9-1 Approximate Settings**

Stud Base		Weld	Weld	Minimum Plate	
Inches	mm	Seconds	Amperes	Inches	mm
1/4	6.4	0.20	425	0.048	1.22
5/16	7.9	0.25	500	0.060	1.52
3/8	9.5	0.33	550	0.075	1.91
7/16	11.1	0.40	675	0.089	2.26
1/2	12.7	0.55	800	0.120	3.05


**9.2 Weld Test and Inspection**

Testing of weld quality beyond visual inspection varies with stud characteristics.

Refer to AWS (American Welding Society) Structure Welding code AWS D.1Rev. 1-76.

Welding procedures are covered in Sections 4.28 and 4.29.

Weld test and inspection is covered in Section 4.30, paragraphs 1 through 4. (American Welding Society, inc., 2501 N.W. 7th. Street, Miami, Fla. 33125)

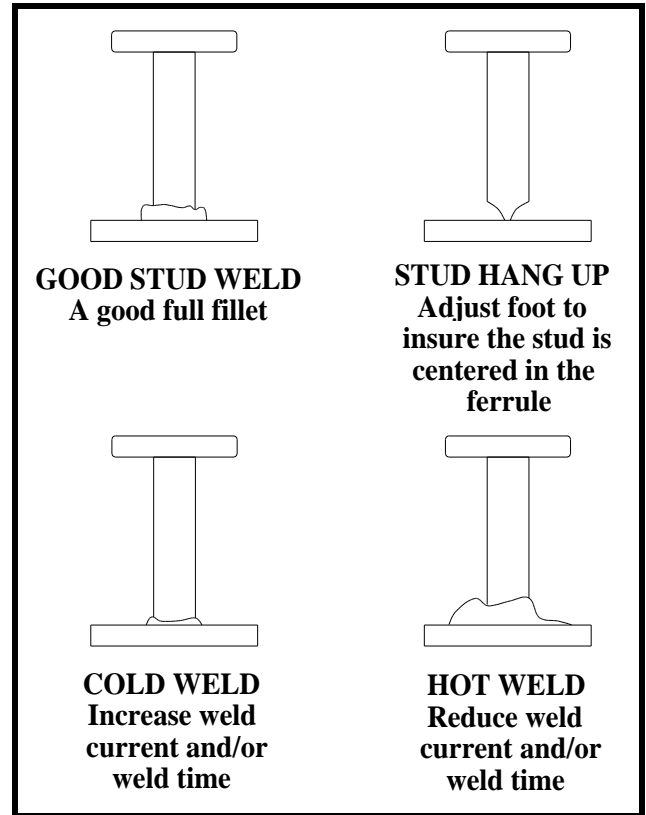

**figure 4  
WELD INSPECTION**

**A. Bend Test**

Repeatedly bend the stud away from its axis until failure occurs.

**B. Torque Test - Threaded Studs**

Twist the stud to point of failure. Apply a twisting tensile load by using a collar, washer and nut.

**C. Test Results**

In an acceptable weld, failure will occur in the stud material or tear out of a thin base plate. Failure in the weld requires adjustment of procedure, weld time, weld current, or gun

setup.

**10.0 MAINTENANCE**

**CAUTION**

**Electric Shock Can Kill:**

- Do not touch live electrical parts.
- Shut down welding power source, and disconnect input power before inspecting, maintaining, or servicing.

Lockout/tagging procedures consist of padlocking line disconnect switch in the open position, removing fuses from fuse box, or shutting off and red-tagging circuit breaker or other disconnecting device.

**MOVING PARTS can cause serious injury.**

- Keep away from moving parts.

**HOT SURFACES can cause severe burns.**

- Allow cooling period before servicing.

**CAUTION**


**Read and follow the safety information at the beginning of this section before proceeding.**

**10.1 Weld Cables**

Every three months inspect cables for breaks in insulation. Repair or replace cables if insulation breaks are present. Clean and tighten connections at each inspection.

**10.2 Internal Cleaning**

Every six months blow or vacuum dust and dirt from the inside of the welding power source. Remove the outer enclosure, and use a clean, dry airstream or vacuum suction for the cleaning operation. If dusty or dirty conditions are present, clean the unit monthly.

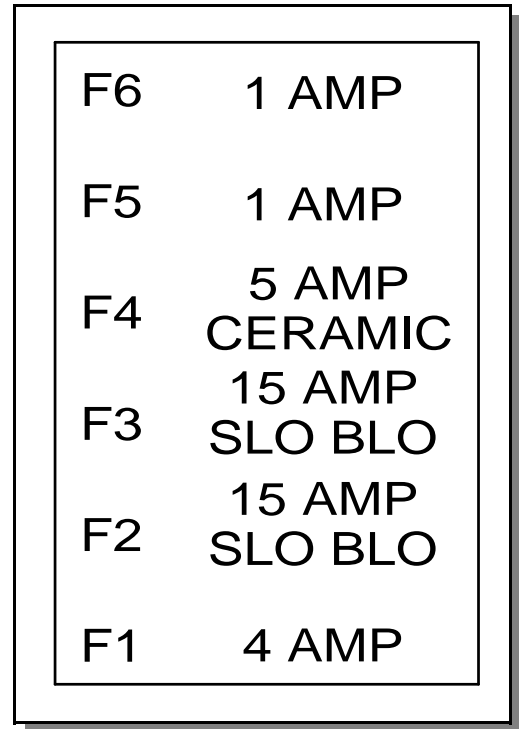

**Figure 5  
FUSE BLOCK**


**11.0 TROUBLE SHOOTING**

**CAUTION**


**Read and follow the safety information at the beginning of this section before proceeding**

Whenever possible, have a qualified electrician do the maintenance and trouble shooting work. Turn the input power off using the disconnect switch at the fuse box before working inside the machine.

<b>Trouble</b>	<b>Possible Cause</b>	<b>What To Do</b>
Unit trips off without welding.	<ol style="list-style-type: none"> <li>1. Defective main SCR.</li> <li>2. Defective sustaining arc SCR.</li> <li>3. Unit Overheated.</li> <li>4. Defective thermal switch.</li> <li>5. Defective 600-0015 P.C. board.</li> <li>6. Shorted control cables.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check for defective SCR and replace.</li> <li>2. check and replace.</li> <li>3. Allow unit to cool/ then reduce weld rate to prevent reoccurrence.</li> <li>4. Check and replace.</li> <li>5. Replace.</li> <li>6. Repair.</li> </ol>
Low output.	<ol style="list-style-type: none"> <li>1. Low incoming line voltage</li> <li>2. Incorrect jumper link connection on primary board.</li> <li>3. Defective 600-0015 P.C. board.</li> <li>4. Defective current potentiometer.</li> <li>5. Excessive weld cable length.</li> </ol>	<ol style="list-style-type: none"> <li>1. Current low line voltage.</li> <li>2. Check jumper links on primary board for proper voltage.</li> <li>3. Replace.</li> <li>4. Replace.</li> <li>5. Reduce cable length.</li> </ol>
Maximum output but no control.	<ol style="list-style-type: none"> <li>1. Defective 600-0015 P.C. board.</li> <li>2. Open lead going to shunt (shielded cable).</li> <li>3. Defective current potentiometer.</li> </ol>	<ol style="list-style-type: none"> <li>1. Replace.</li> <li>2. Repair broken leads on connection.</li> <li>3. Replace.</li> </ol>
Gun does not lift.	<ol style="list-style-type: none"> <li>1. Blown 4 amp fuse.</li> <li>2. Defective 600-0015 P.C. board.</li> <li>3. Defective control cable or gun coil.</li> <li>4. Defective trigger switch on gun.</li> <li>5. Blown 1 Amp fuse.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check and replace fuse.</li> <li>2. Replace.</li> <li>3. Repair short in cable, replace gun coil.</li> <li>4. Replace.</li> <li>5. Replace.</li> </ol>
Gun lifts but does not weld.	<ol style="list-style-type: none"> <li>1. Blown 15 amp sustaining arc fuse.</li> <li>2. Defective sustaining arc SCR(s).</li> <li>3. Defective 600-0015 P.C. board.</li> <li>4. Defective choke coil.</li> <li>5. Open weld cable or bad weld ground connection.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check and replace fuse.</li> <li>2. Replace bad part(s).</li> <li>3. Replace.</li> <li>4. Check and Replace.</li> <li>5. Check and Repair.</li> </ol>
Gun lifts but does not Plunge.	<ol style="list-style-type: none"> <li>1. Defective 600-0015 P.C. board.</li> <li>2. Defective time potentiometer.</li> <li>3. Bind within welding gun.</li> </ol>	<ol style="list-style-type: none"> <li>1. Replace.</li> <li>2. Replace.</li> <li>3. Perform gun maintenance</li> </ol>

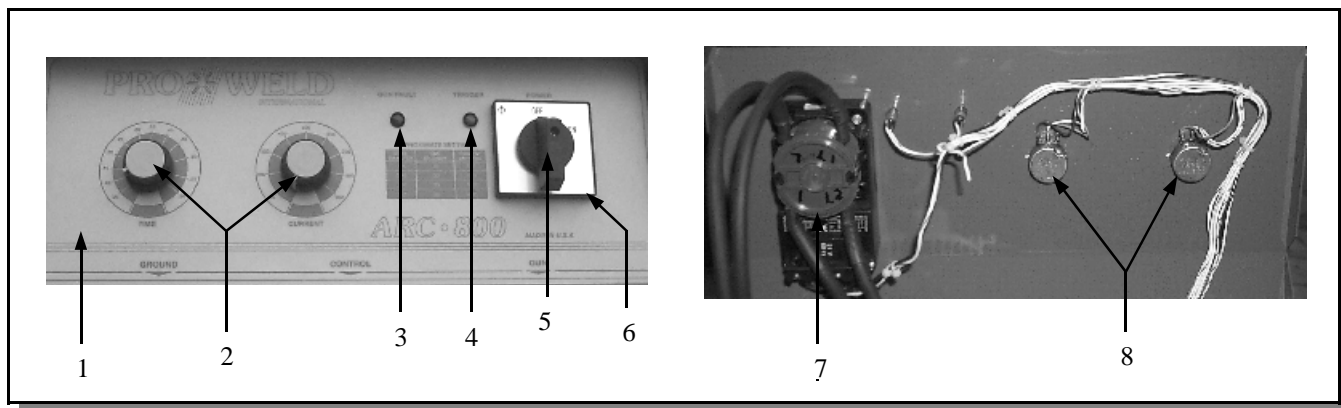


**Figure 6**  
**FRONT PANEL**

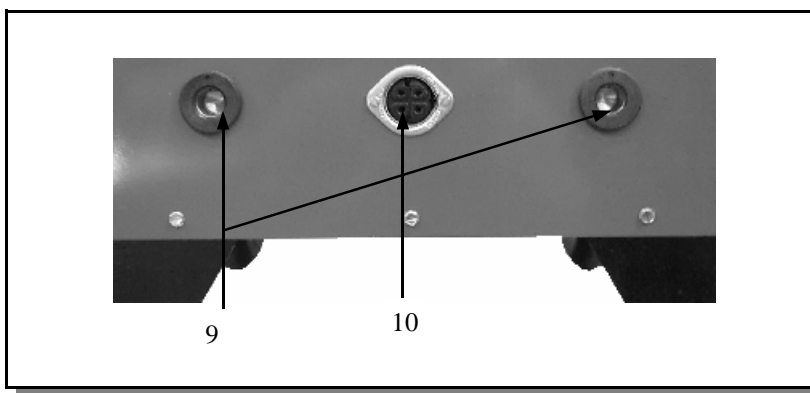

**Figure 7**  
**CONNECTORS**

**12.0 PARTS LIST**


ITEM	DESCRIPTION	PART NUMBER
1	Front Decal	122-0032
2	Knob	102-0060
3	LED Red	108-0028
4	LED Green	108-0029
5	Knob	104-0043
6	Face Plate	104-0042
7	On/Off Switch	104-0041
8	Potentiometer	111-0001
9	Camlok, Female Panel Mount	107-0002
10	Panel Mount R&S Connector	107-0001

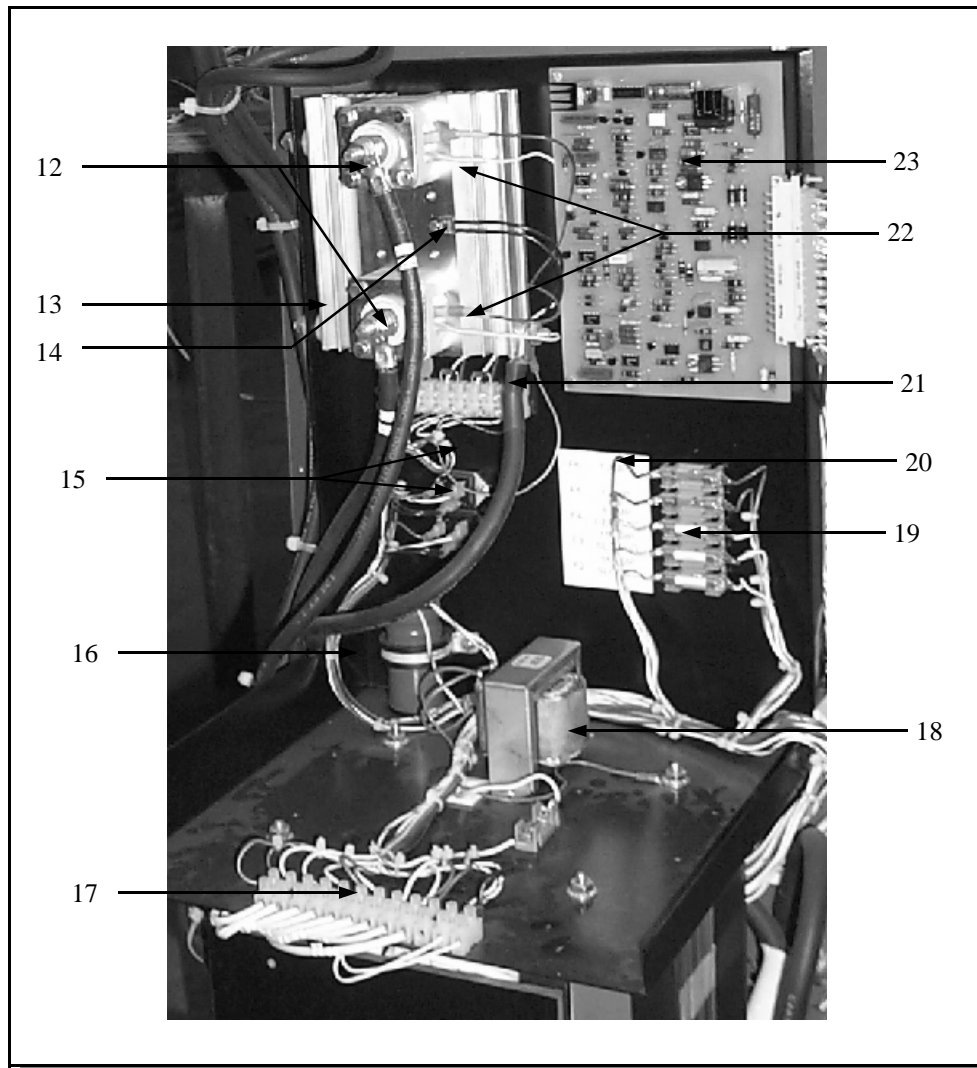

**Figure 8**  
**INTERNAL VIEW**

ITEM	DESCRIPTION	PART NUMBER
12	SCR Clamp	102-0106
13	Heat Sink	124-0050
14	Thermostat	102-0032
15	SCR, Isolated 25A 400V	108-0042
16	Cap, 1000 MFD 200V	106-0024
17	Terminal Strip 12 Pole Euro	102-0025
18	Choke Coil	105-0004
19	6 Terminal Fuse Block	104-0038
20	Fuse Decal	122-0034
21	Terminal Strip 12 Pole Euro	102-0025
22	SCR	108-0058
23	ARC-800 PCB	600-0015



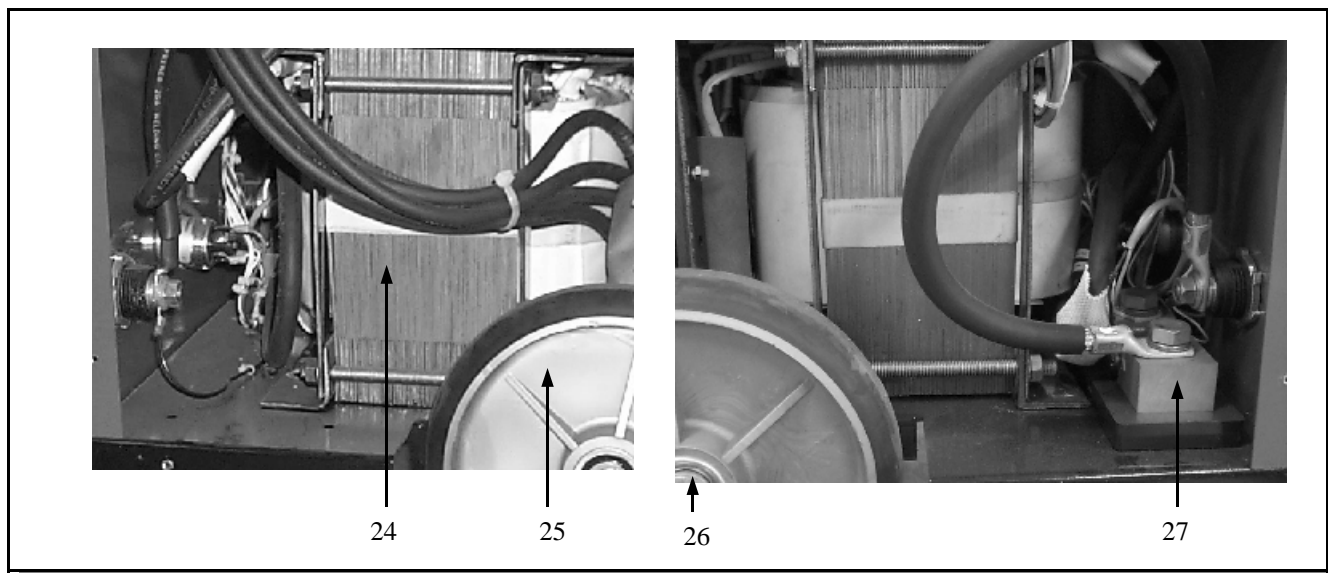

**Figure 9**  
**INTERNAL VIEW**

ITEM	DESCRIPTION	PART NUMBER
24	M/TRANS/500 208/230/460/60hz	105-0003
25	Wheels	102-0036
26	Axle Cap	102-0027
27	Shunt	102-0081


**Sheet Metal / Misc. Parts**  
(NOT PICTURED)

DESCRIPTION	PART NUMBER
Base	101-0031-1
Left Side Panel	101-0031-2
Right Side Panel	101-0031-3
Top Cover	101-0031-4
Front Panel	101-0031-5
Back Panel	101-0031-6
MTG Panel	101-0031-7
Compartment	101-0031-8
Rear Door	101-0031-9
Handle	101-0031-10
Axle	102-0046
Handle, Plastic	102-0063
Door Latch Knob	102-0124
Door Latch Cam	102-0125





MANUFACTURED BY  
**PRO WELD**  
INTERNATIONAL

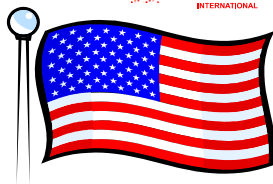

MADE IN THE U.S.A.